

SERVICE BULLETIN



M-846

December 4, 1981

POSITIVE BATTERY CABLE ROUTING 1982 FXR MODELS

Battery Cable Routing

The positive battery cable on 1982 vehicles prior to VIN 1HD1EAK12CY112496, may contact the bottom edge of the battery carrier. This surface could cause premature wear of the cable insulation resulting in an intermittent short circuit.

See Figure 1. Reroute the positive battery cable between the second and third oil hoses leading from the oil tank.

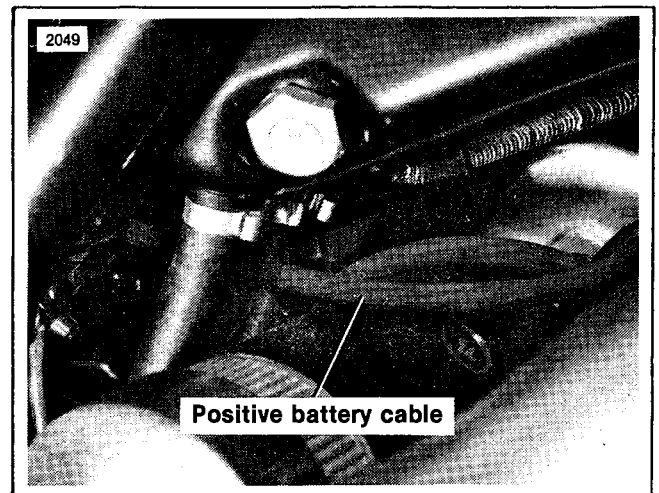


Figure 1. Correct Battery Cable Routing

[illegible]