

SERVICE BULLETIN



M-925

March 25, 1986

HANDLEBAR SWITCHES

Refer to Figure 1. 1982 to 1985 handlebar switches had locating tabs, on one half of the switch housing, which fit into indents or slots in the mating half of the switch housing. Beginning with 1986 models, the housings no longer have the tabs or slots in the switch housing contact surfaces.

Stock switch housings for repair parts orders presently have the tabs. When fitting a switch housing, (parts order stock) that has the tabs, to a switch housing that no longer has the slots, (current production vehicles), it will be necessary to grind or file the tabs flush with the base surface prior to assembly.

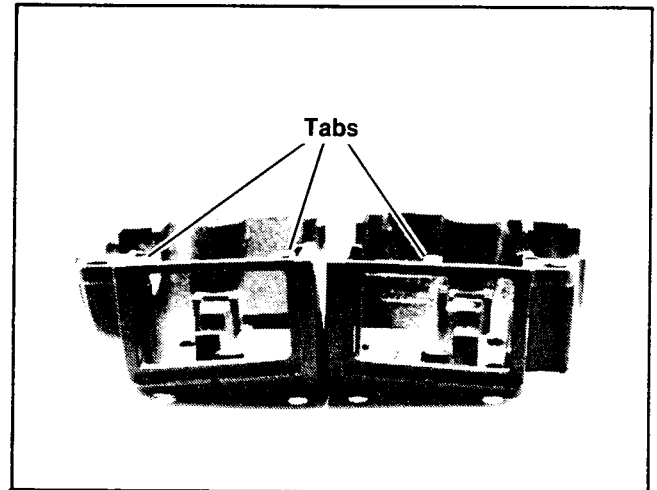


Figure 1. Handlebar Switch Housings

ROUTING:	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	CHIEF MECHANIC	MECHANIC NO. 1	MECHANIC NO. 2	MECHANIC NO. 3	MECHANIC NO. 4	RETURN THIS TO:
INITIAL HERE									