SERVICE BULLETIN

HARLEY-DAVIDSON

COMPANY **

M-972

OCTOBER 28, 1988

FXR REAR BRAKE RESERVOIR/MASTER CYLINDER HOSE

A number of 1989 FXR vehicles have the reservoir/master cylinder hose strapped to the master cylinder/caliper hose. Strapping the hose in this location could pull the hose inward to where the hose would rub against the exhaust mounting bracket. Eventually this could cause wear through the wall of the hose.

All 1989 FXR vehicles, shipped to your dealership, with a vin between 110000 and 114000, must be inspected to determine whether they have the rear reservoir/master cylinder hose cable strapped and if so, the strap must be cut and removed. Do not install another cable strap in some other location as it is not necessary.

The preformed hose does not require any tying down and all FXR vehicles are presently assembled without a cable strap.

Affected Motorcycles

MODEL	FROM (VIN)	THRU
FXR	110000	114000
FXRS	110000	114000
FXLR	110000	114000
FXRT	110000	114000
FXRS-SP	110000	114000
FXRP	110000	114000

ROUTING	SERVICE	SALES	PARTS	LEAD	TECHNICIAN	TECHNICIAN	TECHNICIAN	TECHNICIAN	RETURN
	MANAGER	MANAGER	MANAGER	TECHNICIAN	NO. 1	NO. 2	NO. 3	NO.4	THIS TO
INITIAL HERE									