

SERVICE BULLETIN



M-1117

Safety Recall Code 0104

October 03, 2001

2001 DYNA GLIDE FUEL HOSE CLAMP

Purpose

Harley-Davidson has learned a condition may exist on certain 2001 models that can cause the fuel hose to become disengaged from the carburetor inlet. This condition may cause fuel to spill and burn in the presence of an ignition source which could result in an accident or death or serious injury.

Harley-Davidson has voluntarily declared this a "defect related to motor vehicle safety" and is recalling all potentially affected vehicles to have the fuel hose and clamp inspected.

Motorcycles Affected

All 2001 Dyna Glide Models.

Customer Notification

Harley-Davidson will send letters to registered owners notifying them of this condition and instructing them to contact their Dealer for the fuel hose and clamp inspection.

Attached is a list which contains the vehicle identification numbers (VIN) of all vehicles that were delivered to your dealership and are involved in this recall campaign.

To ensure rider safety, it is your responsibility to perform the required service on all affected vehicles even if the motorcycle was not purchased from your dealership. You will be required to perform the required service on all affected vehicles in your dealership inventory prior to selling or leasing those vehicles.

If you are not sure that a safety recall has been completed on a particular motorcycle, contact the Harley-Davidson Recall Information Line at 1-800-448-1708 for a computer check of our recall records. Recall information is also available on TALON and hdnet.com.

IMPORTANT NOTE

Because only registered owners will receive notification from us, we request that you contact any owners of vehicles that your records show as unregistered. Advise them of the safety recall and make arrangements for them to come in for recall service. We also require that you provide us with their names, addresses and VIN's as soon as possible to enable us to mail them an owner's letter, as required by the National Traffic and Motor Vehicle Safety Act (as amended).

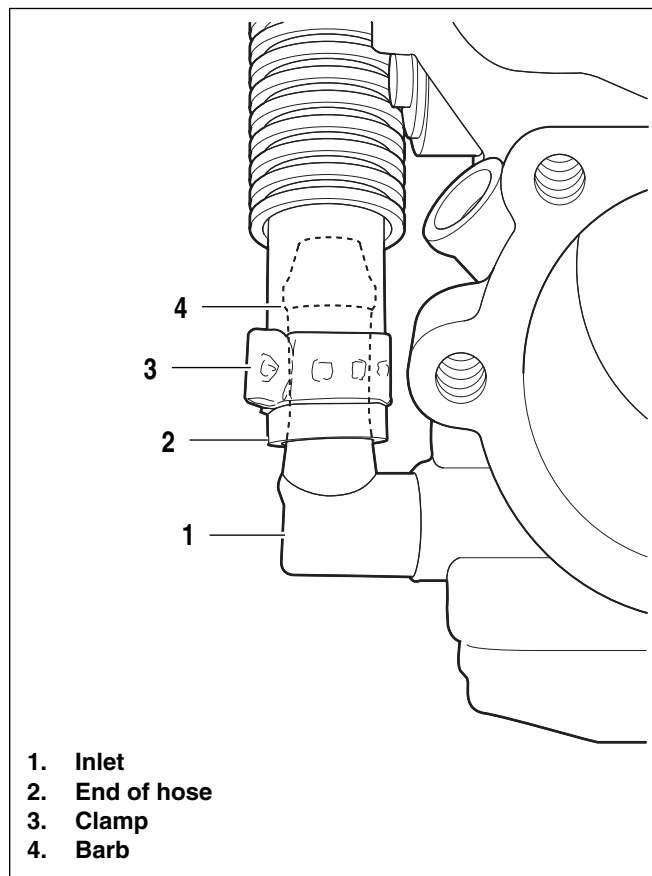


Figure 1. Fuel Hose And Clamp

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO.1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	TECHNICIAN NO. 4	RETURN THIS TO
INITIAL HERE									

Required Dealer Action

1. Remove air cleaner cover and backing plate according to the 2001Dyna Service Manual (Part Number 99481-01).
2. See Figure 1. Inspect fuel hose and clamp. Be sure top of clamp (3) is below barb (4). Verify that end of hose (2) extends past bottom of clamp.
3. If clamp and hose are not in proper position, cut clamp and reinstall hose with new clamp (Part Number 10014) using HOSE CLAMP PLIERS (HD-97087-65B) so hose and clamp positions resemble Figure 1.
4. Install air cleaner cover and backing plate according to the 2001Dyna Service Manual (Part Number 99481-01).

Credit Procedure-Clamp and Hose Out of Position–Correct

For each vehicle your dealership has remedied, fill out a Dealer Service Card. Be sure to list the recall (service code) number (0104) on the card. Place a “C” in the letter box. When Harley-Davidson receives your properly completed Dealer Service Card, you will be credited 0.3 hours of labor for performing the procedure, which includes both 0.1 hour for administration time and credit for the new clamp.

Credit Procedure-Clamp and Hose In Proper Position–Inspect

For each vehicle your dealership has inspected and no correction was necessary, fill out a Dealer Service Card. Be sure to list the recall (service code) number (0104) on the card. Place an “I” in the letter box. When Harley-Davidson receives your properly completed Dealer Service Card, you will be credited 0.2 hours of labor for performing the inspection, which includes both 0.1 hour for administration time.