# **SERVICE BULLETIN**

M-1127 November 15, 2002

#### TWIN CAM UPPER CONNECTING ROD BUSHING SPECIFICATIONS

### **Purpose**

Please be advised that the upper connecting rod bushing specifications in the service manuals are not correct. See REQUIRED DEALER ACTION for the correct specifications.

# **Motorcycles Affected**

All 1999 thru 2003 Twin Cam engines that require possible replacement of the upper connecting rod bushing.

# **Required Dealer Action**

Use the following specifications when measuring for wear or after reaming and honing.

**Table 1. Manufacturing Tolerance** 

Connecting Rod	IN.	ММ	
Piston pin fit (loose)	0.0007-0.0012	0.018-0.030	

#### **Table 2. Service Wear Limit**

Connecting Rod	REPLACE IF WEAR EXCEEDS			
Connecting floa	IN.	ММ		
Piston pin fit (loose)	0.002	0.051		

#### IMPORTANT NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO.1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	TECHNICIAN NO. 4	RETURN THIS TO
INITIAL HERE									
©2002 HARI FY-DAVIDSON MOTOR COMPANY									

M-1127 1 of 1