

SERVICE BULLETIN



M-1253

July 30, 2009

2008-2010 FXDF/FXDFSE AND 2010 FXDWG CRITICAL FASTENER LIST UPDATE

Purpose

The purpose of this bulletin is to inform technicians to check exhaust bracket torque at every service interval. The powder-coated surface yields in the joint clampload over time. Performing this torque procedure at every service interval will prevent loosened or broken fasteners.

Motorcycles Affected

2008-2010 FXDF/FXDFSE models and 2010 FXDWG, in both U.S. and non-U.S. markets.

Required Dealer Action

See Figure 1. Tighten exhaust bracket mounting bolt (2) and flange nuts (1) at transmission to 15-19 ft-lbs (20.3-25.8 Nm) at every service interval in addition to other fasteners on the critical fastener list.

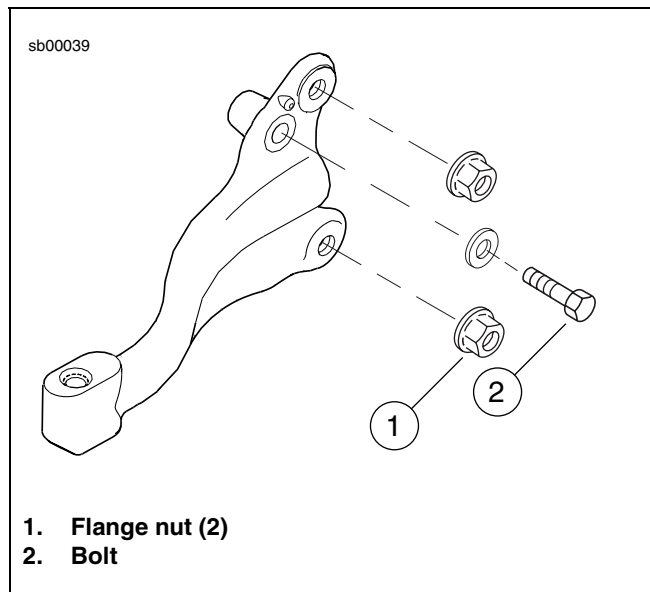


Figure 1. Dyna Exhaust Bracket

IMPORTANT NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO.1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	RETURN THIS TO
INITIAL HERE									

©2009 H-D