# SERVICE BULLETIN



M1522 2021-02-16

# M1522: 2021 TOURING - POWER OUTLET - PINNED INCORRECTLY

## Reason for Revision

**Table 1. Document History** 

Date	Revision Description
	Wording and date updates.
2021-02-16	Updated Purpose for Service Bulletin, Motor- cycles Affected, Required Dealer Action
2021-02-13	Initial release

# **Purpose for Service Bulletin**

This bulletin is to notify Dealers that the inner fairing front power outlet [132B] on certain 2021 Touring, Touring Police and Trike Models may have been pinned incorrectly.

# **Motorcycles Affected**

All 2021 vehicles in Table 2 built on and or before 2021-02-11.

#### NOTE

Vehicles built on 2021-02-12 and later do not need to be verified and are not part of this bulletin.

Table 2. Affected 2021 Models

Platform	Model				
Touring	FLHT, FLHTK, FLHTK Shrine, FLHX, FLHXS				
Touring Police	FLHTP				
Trike	FLHTCUTG (AUS and CHN markets are not included in this bulletin)				

#### Markets Affected

All markets are affected.

## **Required Dealer Action**

- 1. Remove outer fairing. See the service manual.
- 2. Locate [132B].

#### NOTE

[132B] is a 2-way, Delphi, Unsealed (GY) connector.

a. See Figure 1. Visually check to verify the correct wire location. Refer to Table 3.

- If wiring is incorrectly pinned: Remove wiring and install into correct terminals. See the Electrical Diagnostic Manual (EDM).
- 4. Install outer fairing. See the service manual.

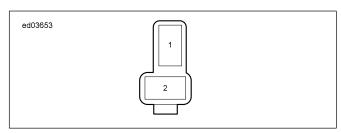


Figure 1. Front Power Outlet [132B]

Table 3. Front Power Outlet [132B]

TERMINAL	WIRE COLOR	CIRCUIT DESCRIPTION				
1	V/BE	P&A relay power				
2	BK	Ground				

### **Credit Procedure**

#### NOTE

Enter bulletin number into comment section of claim.

Submit a warranty claim per Table 4 for each verification/verification and repair of the front power outlet connector.

## NOTE

A vehicle can be verified/verified and repaired one time only.

Table 4.

ITEM	DATA
Claim Type	PRD/PDI Claim or
Claim Type	MC/Standard Claim
Problem Part Number	69202523
Quantity	Leave Blank
Labor Code <sup>(1)</sup>	5094
Time	0.3 h
Customer Concern Code	9210
Condition Code	4102
(1) Download may be required	

NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service

in the interest of preserving earlier earlier and a called action, among the earlier interest any meterogene in preserving earlier maintenance of earlier meterogene in the earlier action and maintenance of earlier meterogene in the earlier and the earlier meterogene in the earl									
ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO. 1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	RETURN THIS TO
INITIAL HERE									