


2. Applied pressure

Figure 2. Suspect Area

3. See Figure 3. Missing seat foam padding.


- a. **Root Cause:** During installation, the rear of the seat must be pulled over the two thumb screws (3). It happens to be that the foam padding in the rear corner folds back into the seat during the installation.
- b. **Repair:** The foam padding can be repositioned with one finger through the opening of the seat bottom.

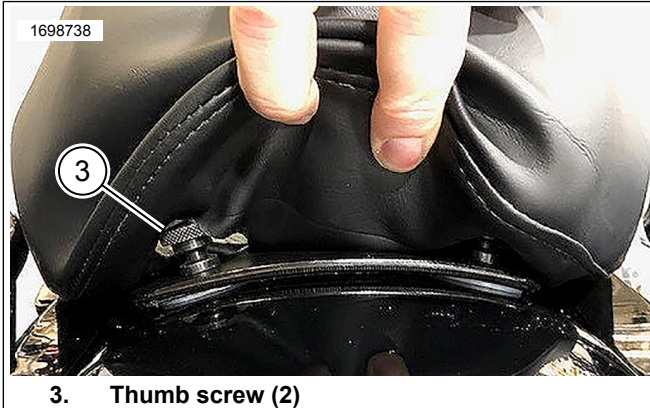

3. Thumb screw (2)

Figure 3. Root Cause


4. See Figure 4. The same bike seat is shown after the foam padding has been properly seated (4). There is no visible sunken area.

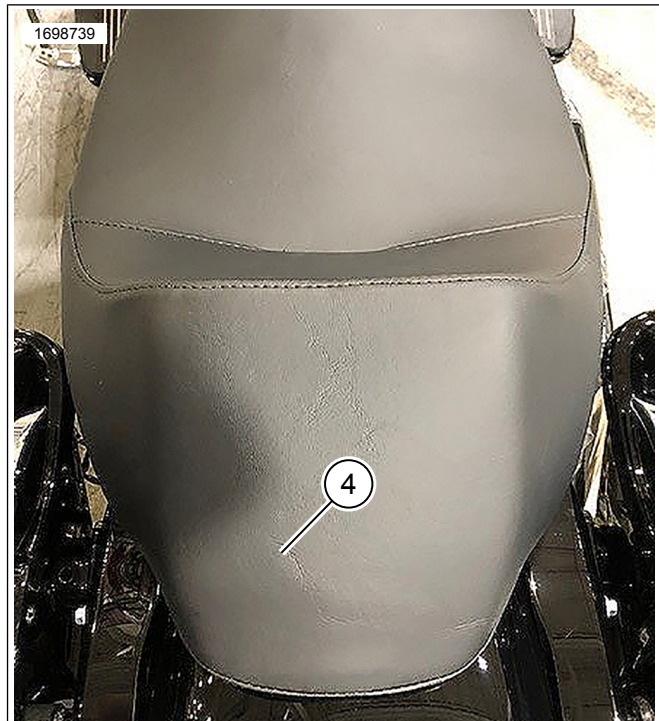

4. Properly seated

Figure 4. After Repair

5. See Figure 5. A push test (5) on the rear of seat confirms that the foam padding has been properly adjusted.

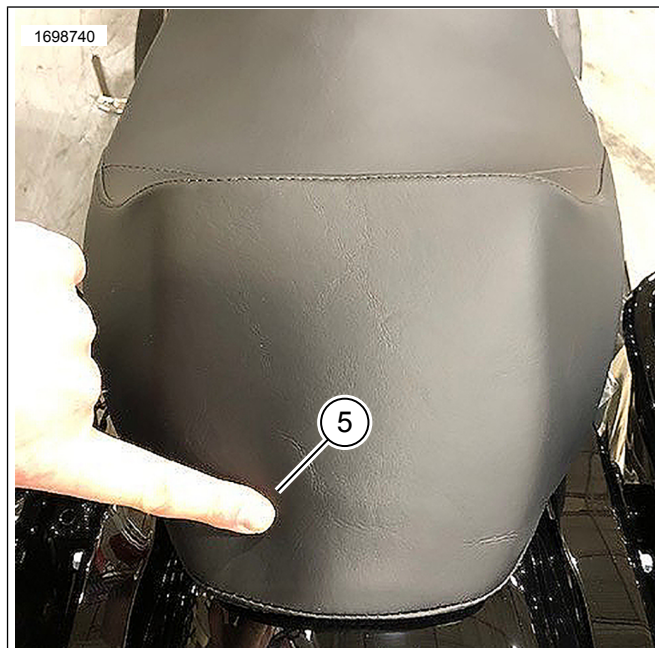

5. Push test

Figure 5. Proper Adjusted Padding

Credit Procedure

NOTE

Enter **XXXX** (will need to enter bulletin number here) in Event Comments.

Submit a warranty claim per Table 4.

Table 4.

ITEM	DATA
Claim Type	PRD/DEM/MC or PDI Claim/Standard Claim
Problem Part Number	52000634
Quantity	Leave Blank
Primary Labor Code ⁽¹⁾	2506
Time	0.1 h
Customer Concern Code	6204
Condition Code	2201
<i>(1) Download may be required</i>	