

SERVICE BULLETIN

B-065

August 22, 2006



ULYSSES SERVICE LITERATURE UPDATE

Purpose

The orientation of the removable diode in the fuse block was shown incorrectly in the 2006 and 2007 XB12X Ulysses owner's and service manuals. If the diode is installed in this orientation the vehicle will only start with the clutch lever pulled in, even with the transmission in neutral.

Motorcycles Affected

2006 and 2007 Buell XB12X Ulysses models.

Required Dealer Action


Notify customers and service personnel of service bulletin. Recent 2007 XB12X owner's manuals will have a corrected fuse block figure as shown in this bulletin. Please correct this figure in 2006 and 2007 owner's and service manuals in your dealer stock. Following is a list of manuals and affected pages.

- **2006 XB12X Ulysses Model Owner's Manual Part No. 99477-06Y**
Page 112 Figure 48
- **2007 XB12X Ulysses Model Owner's Manual Part No. 99477-07Y**
Page 106 Figure 45
- **2006 XB12X Ulysses Model Service Manual Part No. 99494-06Y**
Page 5-11 Figure 5-5
- **2007 XB12X Ulysses Model Service Manual Part No. 99494-07Y**
Page 5-11 Figure 5-5

NOTE

The Fuses, Relays and Diode: Ulysses XB12X Models illustration will be on different pages for International translations.

1231x1xa.eps

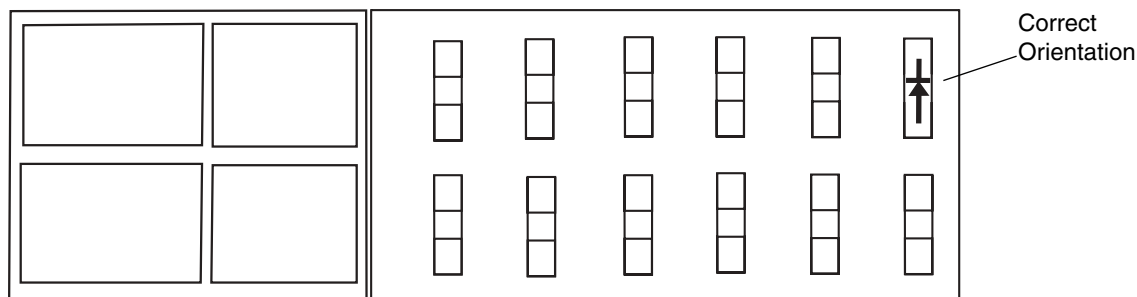

Fuses, Relays and Diode: 2006, 2007 Ulysses XB12X

IMPORTANT NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO.1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	TECHNICIAN NO. 4	RETURN THIS TO
INITIAL HERE									