

TECH TIPS # 21  
9/10/90

IMPORTANT INFO: 1991 Sportster Voltage Regulator Wire Rerouting.

1991 XL assembly variations could cause contact between the black voltage regulator wire and the oil tank or transmission vent hose. The voltage regulator wire is connected to the silver stud on the main circuit breaker. (See the drawing below) To correct this condition, please rotate the regulator wire from "A" position to the "B" position. Should this not be done the connector may fail leading to regulator damage and an inability to maintain the batteries state of charge. Thank you!

