

2007 XL Low Fuel Warning Light update

There is now an updated speedometer calibration available on DTII. This only applies to MY2007 Sportster Motorcycles.

This non-chargeable calibration change is to correct premature Low Fuel Warning Light activation. You will also need to install a new resistor pack (P/N 72545-08) along with this speedometer calibration change.

This is a warrantable upgrade, but should only be performed on vehicles with a specific complaint of this symptom.

Use labor code 6083 for .3 hours for replacing the resistor and installing the upgraded calibration. This update can be found on DTII under Toolbox and then Vehicle Setup tab.



The screenshot displays the DTII software interface. At the top, there is a toolbar with various icons including a motorcycle, a toolbox, a warning sign, and a globe. Below the toolbar, the 'Vehicle Setup' menu is open, listing several options: Idle Adjust, Module Replace, AFV Reset, PIN, HFSM Customization, and Low Fuel Warning Light. The 'Low Fuel Warning Light' option is highlighted. The main content area shows a 'CAUTION: Do NOT update any Sportster until a new termination resistor (P/N 72545-08) has been installed.' message. Below this, there is a text box that says 'Select "Update Now" to recalibrate the Low Fuel Warning Light circuit.' and a large 'Update Now' button.