

07 XL Model Chain Inspection Cover Leaks

Recently there has been an increase in warranty on primary chain inspection cover leaks. To provide a superior end product to our mutual consumers, we'd like to better understand the root cause.

Please make sure that during the first service, any residual fluid is cleaned from the primary cover and the inspection cover surfaces and a new gasket (P/N 34986-04), is being used. The torque spec. on the fasteners is 40-60 INCH LBS. Following this practice is the best way to prevent fluid leaks.

If the fluid leak is prior to the initial service and was not checked at the PDI, or if there is a repeated fluid leak and the gasket has previously been replaced, please call Tech Service with the VIN and mileage. Further direction will be determined depending on the information provided. In most cases a new primary cover or a new inspection cover is not required.