



TT403: 2009 Sidecar Battery Tray Fitment

March 26, 2009



Chassis

| APPLIES TO | SYMPTOMS |
|---------------------------|--|
| Early 2009 FL motorcycles | • Part Availability, Installation or Fitment Updates |

2009 Sidecar Battery Tray Fitment

Early 2009 FL motorcycles that will have a sidecar installed require a new battery tray (part number 66281-09A or later revision) for proper bank angle sensor mounting.

Beginning with the launch of 2009 model year sidecars, a new battery tray was included with each sidecar in the event that it was needed. The build range for these motorcycles is from the start of 2009 production through October 10, 2008. Motorcycles assembled after 10/10/08 were built with the later battery tray and do not require battery tray replacement for sidecar applications.

The later battery tray can be identified by the words "sidecar tip sensor" in the location shown in Figure 1 below.

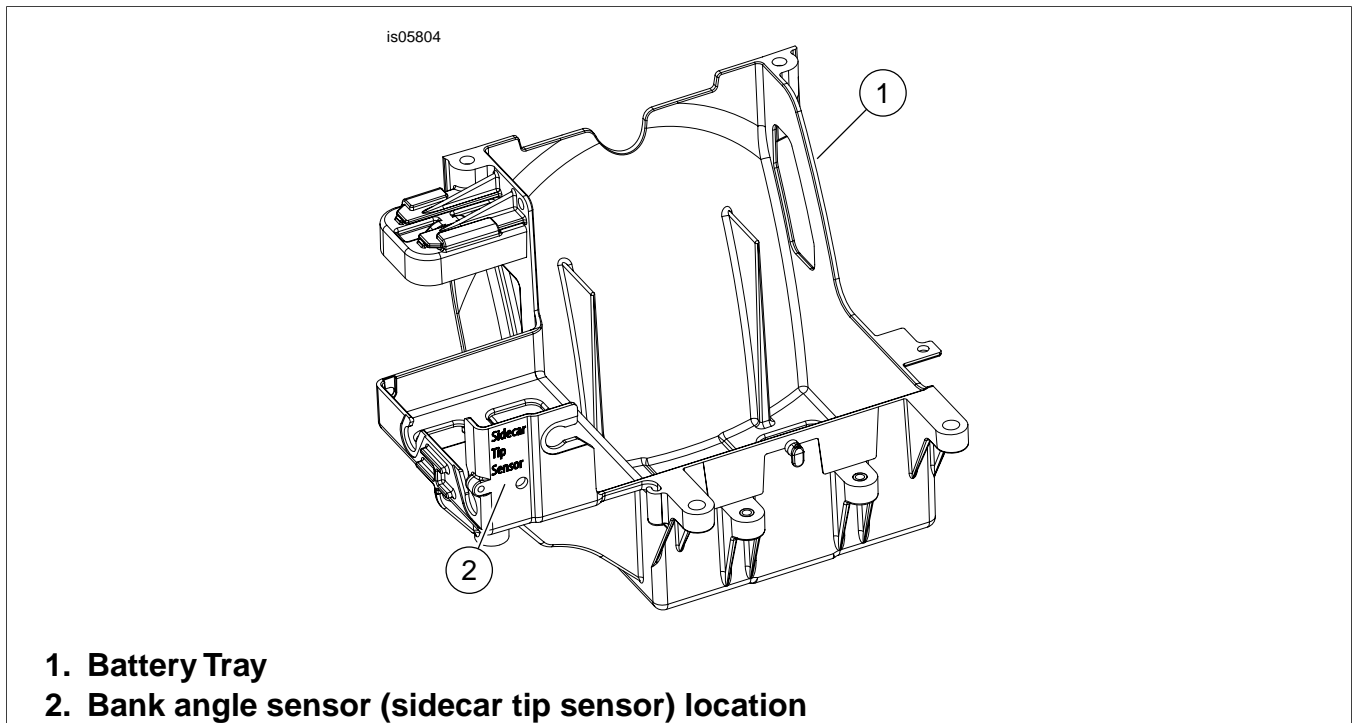


Figure 1. Battery Tray For Bank Angle Sensor

If the words "sidecar tip sensor" do not appear as shown in figure 1, the tray is an early version that must be changed before a sidecar installation may be completed.

As of March 2009, this battery tray will no longer be provided with each sidecar. Using the motorcycle's VIN provided with the sidecar order, we will determine if a new tray is needed by the assembly date. If one is required, a "no charge" part order will be automatically generated to ship a battery tray to the dealer that ordered the sidecar. The order will reference the sidecar order number.

Information related to this is included in the instruction sheet for the 2009 Bank Angle Sensor kit, part number 88115-09.