

2/ 5-19-14



TT434: DAYMAKER HEADLAMP CALIBRATION UPDATE

April 14, 2014



Electrical

SB-10055749-3393

APPLIES TO	SYMPTOMS
Certain 2011-2013 Softail and 2012-2013 Dyna models equipped with P&A Daymaker LED Headlamp	• Intermittent or Erratic Electrical Operation

Certain 2011-2013 Softail and 2012-2013 Dyna model motorcycles that are equipped with a P&A Daymaker Headlamp may experience a diagnostic trouble code (DTC) (B2131 or B2136). This is due to the lower current draw of the LED headlamp as compared to halogen. Reflashing the BCM calibration using Digital Technician II will resolve this issue.

This calibration is only for BCM Part Numbers:

- 69991-11
- 69991-11A
- 69993-11
- 69993-11A
- 69997-11
- 69997-11A
- 69992-12
- 69994-12
- 69996-12

Procedure

1. Connect Techlink to motorcycle. Start DTII.
2. Enter the VIN. Select the green check mark.
3. Select the "Reflash" icon.
4. Select "BCM" then the green check mark.
5. Select appropriate calibration file then the green check mark.
6. Follow the screen prompts to complete the reflash.