

SERVICE BULLETIN



M-1199

Safety Recall Code 0126

November 30, 2006

2006 DYNA BATTERY CADDY BOLT RECALL

Purpose

Harley-Davidson has determined that a defect relating to motor vehicle safety exists on certain model year Dyna motorcycles, built from June 17, 2005 to February 6, 2006. These vehicles contain a battery caddy bolt (Part No. 4763), which may loosen under normal riding conditions. Should this occur, the bolt can back out which allows the battery to shift position and then hold the battery in a position which may allow the battery terminals to contact the metal battery caddy cover and abrade through the positive terminal protective boot. If this occurs, the battery can short against the cover, causing sparks and possibly a fire, which could cause an accident leading to injury or death.

In the interest of motor vehicle safety and customer satisfaction, Harley-Davidson has elected to initiate a voluntary recall (Campaign 0126) to replace the battery caddy bolt. See REQUIRED DEALER ACTION to perform the recall service.

Motorcycles Affected

This recall applies to all 2006 Dyna model motorcycles built from June 17, 2005 to February 6, 2006. A VIN list specific to vehicles shipped to your dealership is available via h-dnet.com and is no longer attached to mailed bulletins. This list may be found by following this path:

h-dnet.com/Service/Safety Campaign and Product Campaign/Safety Campaign and Open VIN lists. Select 0126 campaign to view VIN list.

NOTE

If the vehicle does not appear on your dealer VIN list, refer to Safety and Product Campaign History by VIN link to verify if vehicle is affected.

Customer Notification

In accordance with Federal regulations administrated by NHTSA, Harley-Davidson Motor Company, Inc. will provide notice to all owners of record of affected products with direction to bring the vehicle in for the recall service.

To protect the safety of our riders, it is our mutual responsibility to ensure the recall service is performed on all affected motorcycles. Therefore, we strongly urge you to perform the recall service even if the motorcycle was not purchased from your dealership.

You are also required to perform the recall service on all affected vehicles in your dealership inventory prior to delivering, renting or leasing those vehicles.

If you are not sure that a safety recall has been completed on a particular motorcycle, check the recall records available on TALON and h-dnet.com.

NOTE

Because only registered owners will receive notification from us, we request that you contact any owners of vehicles that your records show as unregistered. Advise them of the safety recall and make arrangements for them to come in for recall service. We also require that you provide us with their names, addresses and V.I.N. numbers as soon as possible to enable us to mail them an owner's letter, as required by the National Traffic and Motor Vehicle Safety Act (as amended).

Initial shipments of replacement parts (Part No. 94505) will be made the week of December 11, 2006. All kits will be shipped no charge, transportation paid via UPS1. If additional kits are needed, fill in attached order form and fax it to the warranty department at 414-343-8346. Be sure to include your dealer number on the order form.

NOTE

No kit orders will be accepted prior to availability date.

Required Dealer Action

Follow bulletin for proper repair procedures.

Ordering Additional Kits

If additional kits are needed, fill in the attached order form and fax it to the Warranty department at 414-343-8346. You must include your dealer number.

NOTE

No kit orders will be accepted prior to delivery of the first wave of shipment. To efficiently control recall kit inventory, we require that you have submitted a quantity of Recall 0126 claims equal to 60 percent of your initial wave shipment, before additional kit orders will be accepted.

IMPORTANT NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO.1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	WARRANTY PROCESS MANAGER	RETURN THIS TO
INITIAL HERE									

©2006 H-D

Table 1. Safety Recall Code 94505 Kit

Item	Part No.	Quantity
Battery Caddy Bolt (with lockpatch)	4613	1

⚠ WARNING

A Service Manual is necessary for installation of this kit as the rider's safety depends upon correct installation. Improper installation could result in death or serious injury. When reviewing the sections referenced below, be sure to take note of all warnings and cautions.

NOTE

Refer to the 2006 Dyna Models Service Manual (Part No. 99481-06), which contains a reference to instructions on removing the battery.

1. Disconnect and remove battery. See BATTERY MAINTENANCE in appropriate Dyna service manual.
2. See Figure 1. Remove and discard bolt from battery tray.
3. Obtain **new** bolt (Part No. 4613) from recall kit 94505 and install. Tighten bolt to 96-120 **in-lbs** (10.8-13.6 Nm).
4. Install remainder of battery components. See BATTERY MAINTENANCE in appropriate Dyna service manual.
5. Discard original part (Part No. 4763) removed from battery tray.

Credit Procedures for all Talon / h-dnet.com / Lightspeed Warranty Claim Systems Users

For each vehicle serviced, file an electronic warranty claim as follows:

Entry Field	Enter
Claim Type	SRC
Event Problem Part	4613
Quantity	Leave blank
Primary Labor Code*	5726
Time	0.2
Customer Concern Code*	0126
Condition Code*	9981
Replacement Part #	94505
Quantity	1
* These new codes may need to be downloaded into your system.	

Upon receipt of the properly completed recall claim, you will be credited 0.2 hours of labor for performing the recall procedure, plus appropriate market administrative time.

NOTE

Each vehicle recall completion must be filed on an individual claim. Please do not submit additional warranty events on these claims.

Credit Procedures for all other Warranty Claim System Users

For each vehicle serviced, file a claim supplying all necessary information as follows:

- Dealer Number
- Repair Order Number
- Claim Date
- Product Campaign (0126)
- Fix I.D. (C)
- Full seventeen-character V.I.N.

Upon receipt and processing of the transmitted information, you will receive appropriate credit for your market, including; 0.2 hours labor, plus appropriate market administrative time.

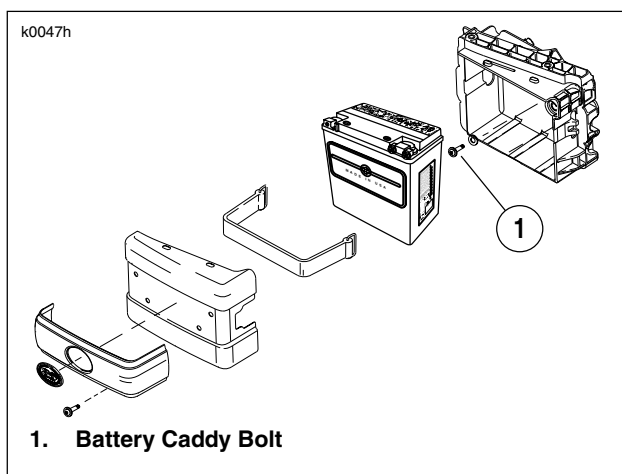


Figure 1. Battery Tray Assembly Bolt



S NAME _____
O L _____
D ADDRESS _____
T CITY/STATE/ZIP _____

S NAME _____
H I P ADDRESS _____
T O CITY/STATE/ZIP _____

TYPE CODE	ORDER TYPE	VEHICLE IDENTIFICATION NUMBER	DEALER ORDER
R	REGULAR		ORDER
P	POLICE		DATE
D	DOWN VEHICLE		DEALER NO.
W	WARRANTY		ORDER TYPE
RC	RECALL		RC
			WARRANTY CLAIM NO.

FOR OFFICE USE ONLY	
ACCT.	1744126
FRT. ACCT	1744126

[illegible]

PLEASE USE PART NUMBERS

DO NOT USE FOR

CORRESPONDENCE

ALL ORDERS SUBJECT TO ACCEPTANCE AT MILWAUKEE. WI 53201

PLEASE ORDER UNDER THE FOLLOWING CONDITIONS OF SALE:

All goods covered by this order, including subject to purchase order, will be shipped prepaid unless otherwise indicated on invoice or shipping slip. Goods are purchased for resale and delivery is made to the FOB destination, Milwaukee, Wisconsin office of one of our customers. This order is accepted subject to availability of goods to seller for delivery to purchaser. Any delay in shipment shall not relieve purchaser of responsibility for this accepted order and seller shall not be liable for any loss or damage due to delay in shipment or failure to deliver. Any request for cancellation of this order or any part thereof must be received by seller prior to the date of shipment, and in case of rescission or return of goods to seller, purchaser shall pay the entire cost connected therewith; plus zero, ten or twenty-five percent of selling price, as determined by Company policy from time to time, as liquidated damages for loss of sale. Purchaser will be responsible for collection and payment of all Federal, State and local taxes that apply on the retail sales.

PLEASE USE PART NUMBERS

DO NOT USE FOR

CORRESPONDENCE

F-1040

PRINTED
IN U.S.A.