


FOOT SHIFTER GEAR TIMING / 1975 FX, FXE

The following is for your information only and will not require any corrective action.

Through a production error, foot shifter gear, part No. 33960-74, on most early 1975 FX/FXE 1200 motorcycles, will have an improperly located timing mark stamped over to obliterate it, and another mark stamped between the next teeth in the correct location.

Although all gears are timed correctly, the first 53 transmissions used in production have gears that were not restamped, and will only appear to be timed incorrectly.

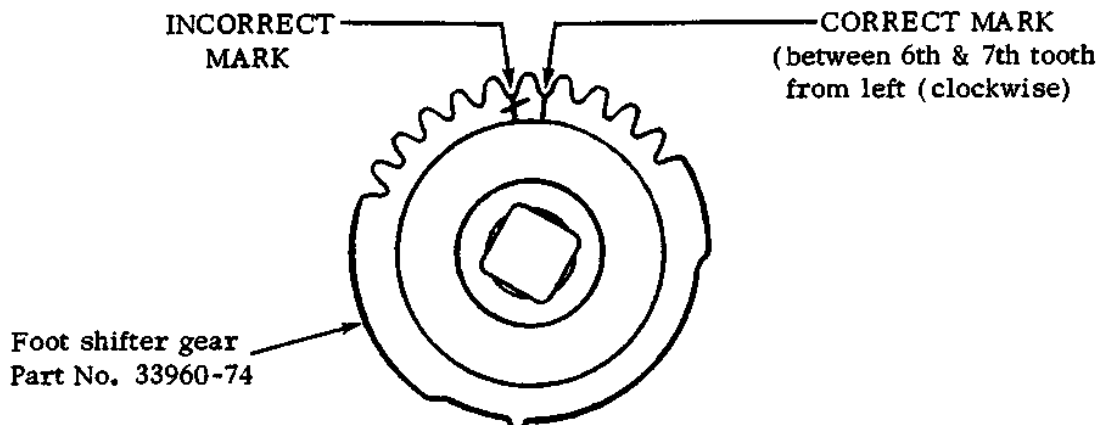

HARLEY-DAVIDSON MOTOR CO., INC.