

SERVICE BULLETIN



M-1255

August 4, 2009

2009 AND 2010 SOFTAIL FUEL LINE AND SPARK PLUG ROUTING

Purpose

To check the routing of 2009 and 2010 Softail fuel line and spark plug wires for proper routing during predelivery inspection (PDI).

Motorcycles Affected

All 2009 and 2010 Softail models except FXCWC.

Required Dealer Action

1. See Figure 1. Check spark plug routing near fuel line. Make sure front spark plug wire is routed on outside of fuel line and that they are not touching.
2. If spark plug wire is incorrectly positioned, re-position spark plug wire as needed.

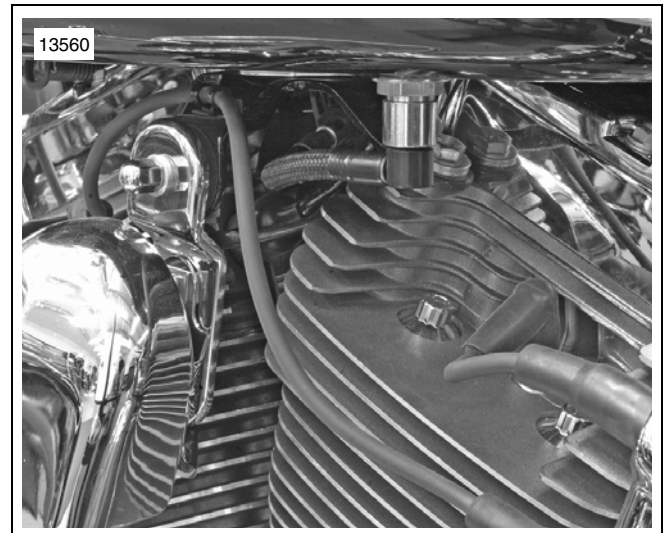


Figure 1. Correct Spark Plug Routing

IMPORTANT NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECH- NICIAN	TECHNICIAN NO.1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	RETURN THIS TO
INITIAL HERE									

©2009 H-D