SERVICE BULLETIN



M1516 2020-06-05

M1516: 2020 TOURING PLATFORM - RUNNING CHANGE - JIFFY STAND HARDWARE

Purpose for Service Bulletin

To inform dealers of a running change to 2020 Touring platform vehicle's jiffy stand hardware and associated service literature updates.

Motorcycles Affected

Table 1. Motorcycles Affected

Year	Platform ⁽¹⁾				
2020	Touring, CVO Touring, Police Touring				
(1) Vehicles built on and after September 16, 2019					

Markets Affected

All markets are affected.

Required Dealer Action

Refer to updated service procedures and new part numbers in Service Information Portal (SIP).

See Figure 1. The following hardware has been changed:

- 1. Flat washer (6702)
- 2. Lock washer (7041)
- 3. Screw (3987)


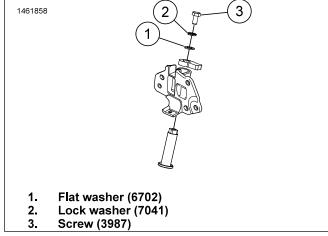


Figure 1. Old Jiffy Stand Configuration

See Figure 2. The hardware has been replaced with:

- 1. New washer (6116)
- 2. New screw with lock-patch (3445)
 - · The torque on this screw has not changed from the service manual.

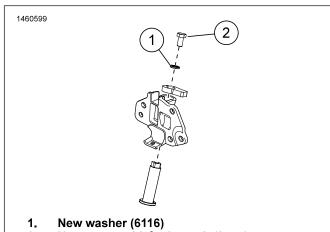

New screw with lock-patch (3445)

Figure 2. New Jiffy Stand Configuration

If the screw needs to be used again, clean threads and apply threadlocker before installation.

LOCTITE 243 MEDIUM STRENGTH THREADLOCKER AND SEALANT (BLUE) (99642-97)

in the line less of preserving customer safety and satisfaction, always check for outstanding recails whenever any motorcycle is brought line your dealership for earlier maintenance of service.											
ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO. 1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	RETURN THIS TO		
INITIAL HERE											