



TT415: Sportster Rocker Cover Hardware Change

July 6, 2009



APPLIES TO	SYMPTOMS
2008 - 2009 Sportster Models	<ul style="list-style-type: none">• Part Availability, Installation or Fitment Updates• Literature Updates or Corrections

In May of 2008 there was a running change to the hardware for all XL rocker covers. This running change did affect the end of 2008 production and all 2009 XL models moving forward.

The change involves the fastener and washer for rocker cover shown in the image below. The washer has been improved for sealing, and the screw was changed to offer better thread engagement.

While these parts are listed correctly in the 2009 XL part catalog, they do retro-fit back to all 1986 and later XL models and 1984 and later Evolution engines.

The following table lists the new and old fastener part numbers.

Table 1. XL Rocker Cover Hardware

Parts	New	Old
Washer	6589	63858-49
Screw	2486	882

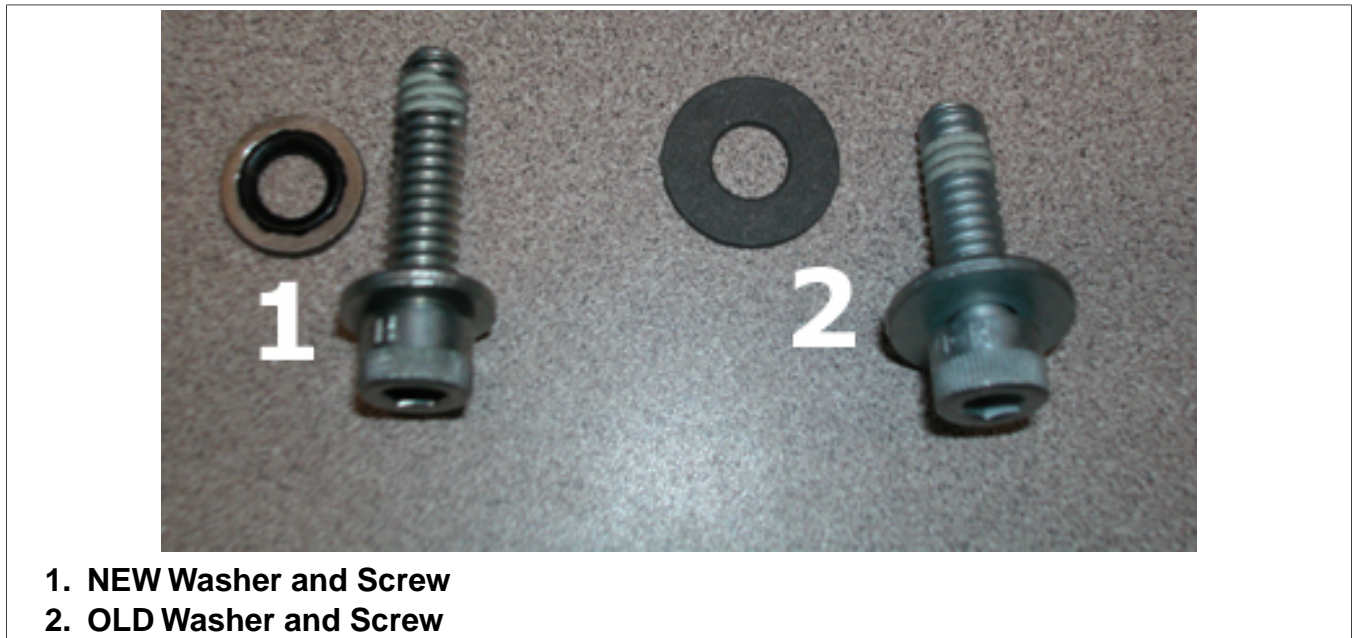


Figure 1. Washer and Screw